

No. : 04 -2007

Group : 314

From : Frank SCHROEDER

Phone no. : 00 33 3 44 61 57 97

Date : 05/03/07

To : Service-Manager of NL/HNL'n and AG'n

**Subject : EXU 16 – 0140, EXU 18 – 0141, EXU 20 - 0142
„BOOMERANG - Side Protection “**



We have received several complaints about damaged or torn off motor covers on EXU – trucks and we have decided to set up in series a metallic protection.

Because of its shape, we call it „ BOOMERANG - side protection“

This side protection can be ordered and added in After-Sales Service under Part no. :


KIT BOOMERANG = 4491910

The Kit 4491910 is made up with following parts :

Description	Quantity	Part no.
Right side Boomerang	1	4492154
Left side Boomerang	1	4492155
Big washer	6	4492156
Screw	6	0501031
Thin washer	6	5447446


The interest of this side protection is to prevent the motor cover from being damaged or torn off when loading or unloading different products.

Basic version of the previous chassis – without any side protection :

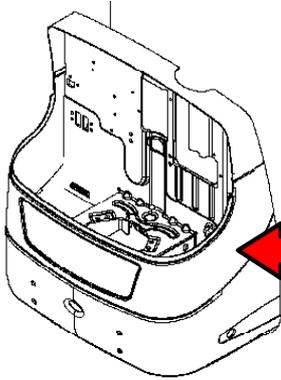


Original version **without**
„Boomerang“

New version :

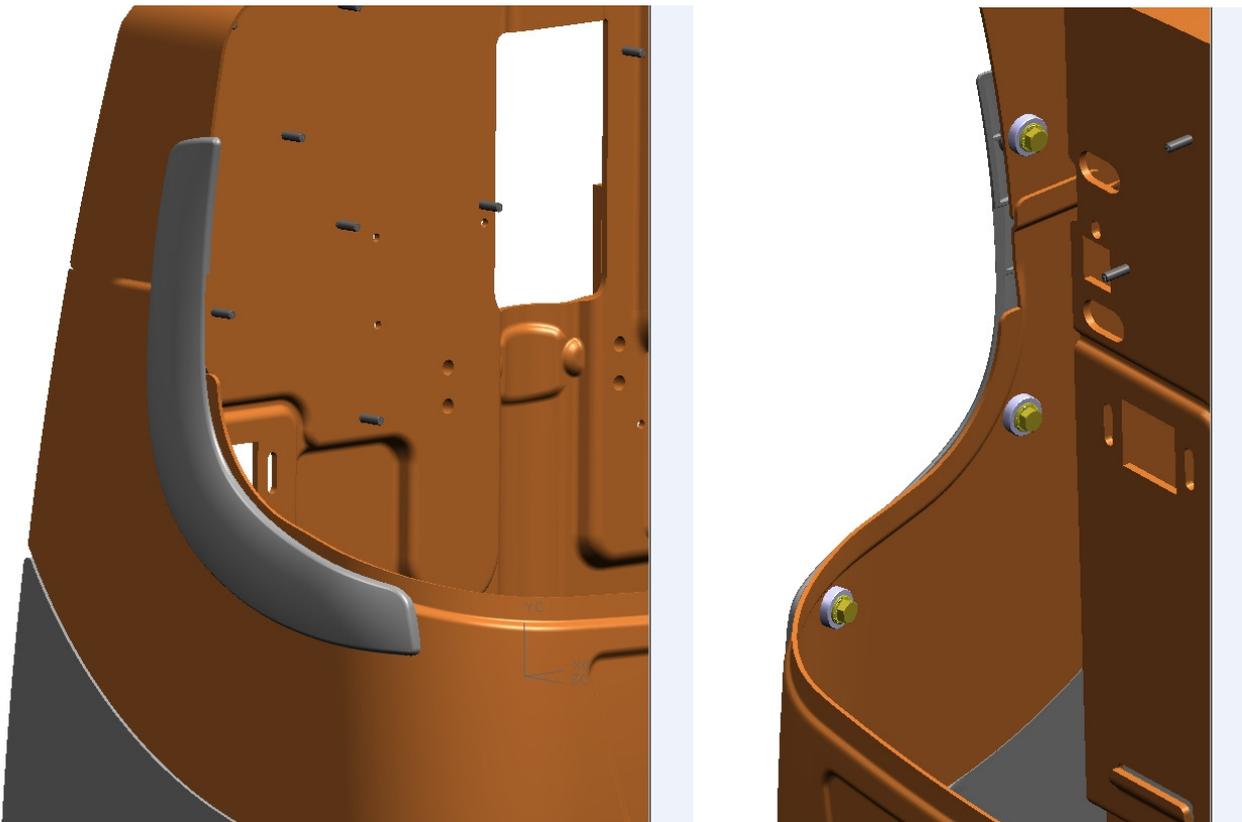

The Boomerang has a slightly curved shape which adapts with precision to the chassis :

Inside Boomerang
with 3 fixing bosses

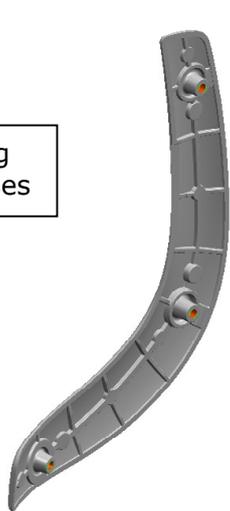


Outside Boomerang
slightly curved



Mounting of the two Boomerangs in After-Sales Service :


Bore 3 holes and add the parts ordered (see below) :

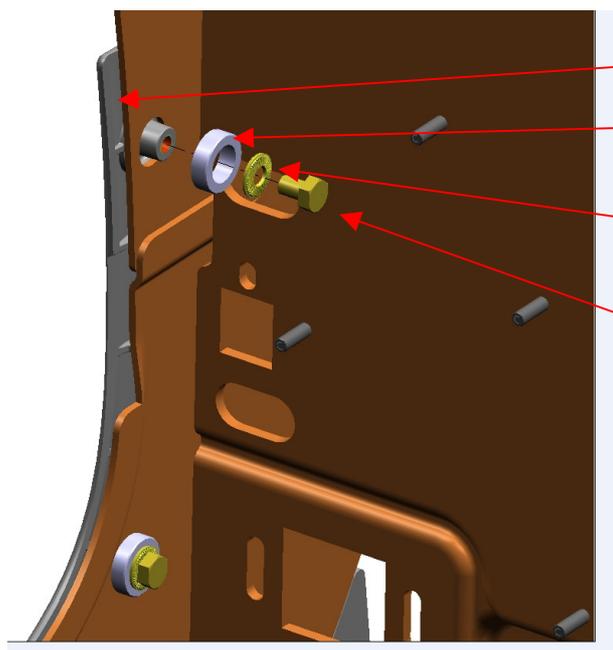

- A) Boomerang**
- B) Big washer**
- C) Thin washer**
- D) Screw**

In the following I joint the mounting plan :

2 holes 17mm diameter &
1 hole 16mm diameter

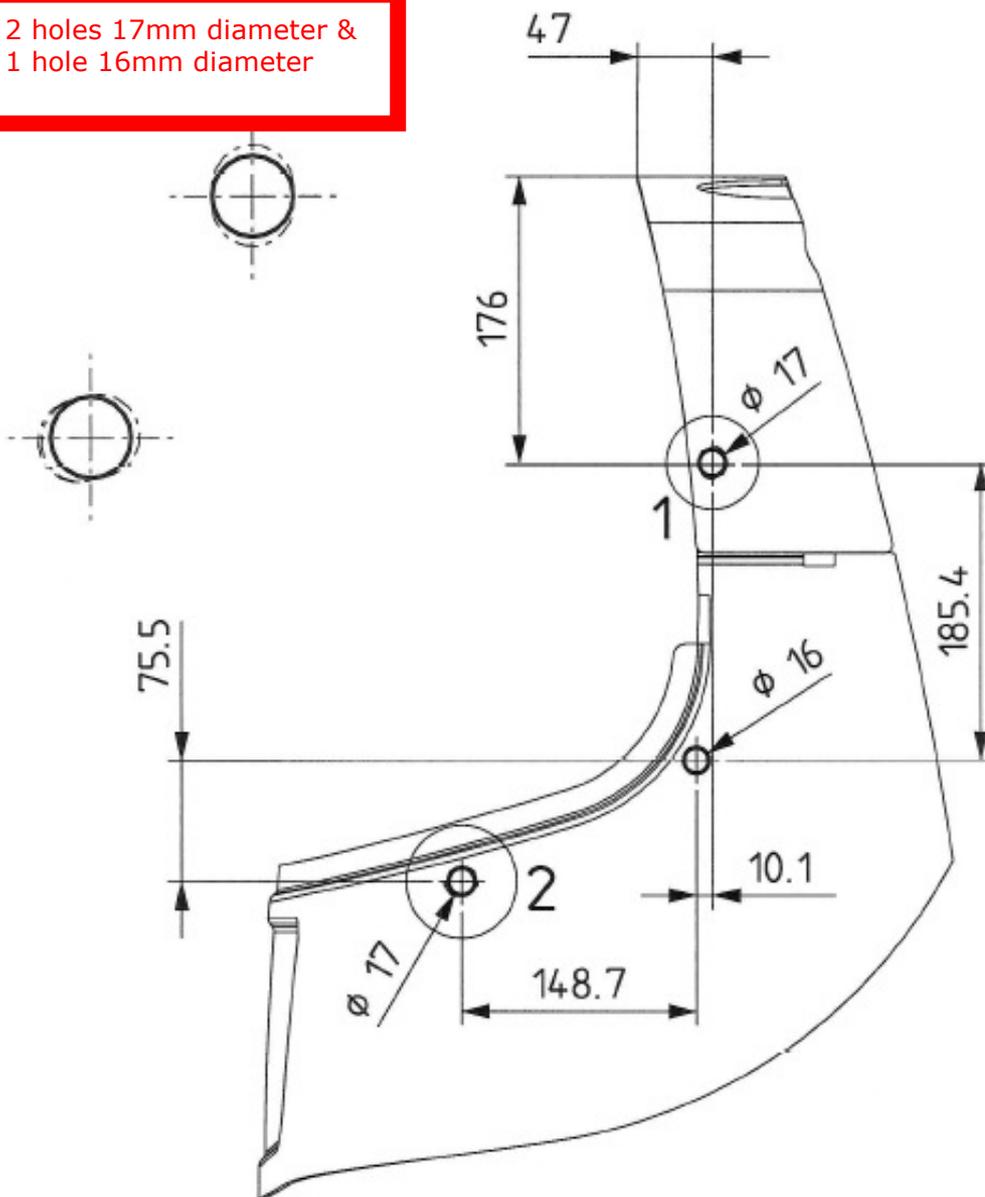

Best regards,

F. SCHRÖDER

